


## MOTOR SPECIFICATIONS




Part Number	<b>X8718-067-35</b>
Step Angle	1.8°
Frame Size (mm/in)	86.00/3.390
"A" Body Length (mm/in)	67.50/2.660
Current (Amps/Phase)	3.5
Holding Torque (oz-in/Nm)	679.74/4.8
Resistance (Ohms/Phase)	0.95
Rotor Inertia (g-cm <sup>2</sup> / oz-in <sup>2</sup> )	915/5
Number of Leads	4
Connection	Bipolar
Weight (lbs/kg)	3.53/1.60

## DIMENSIONS

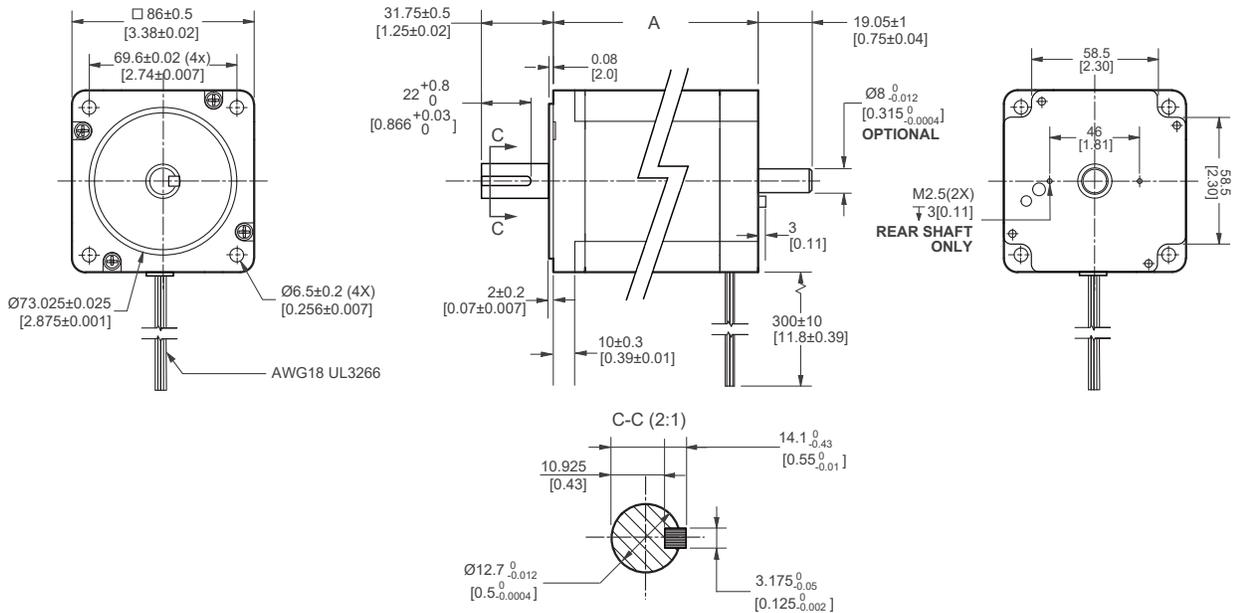

## PERFORMANCE CURVE


**X8718-067-35**  
 48 VDC, 3.5 AMP, 1/2 stepping

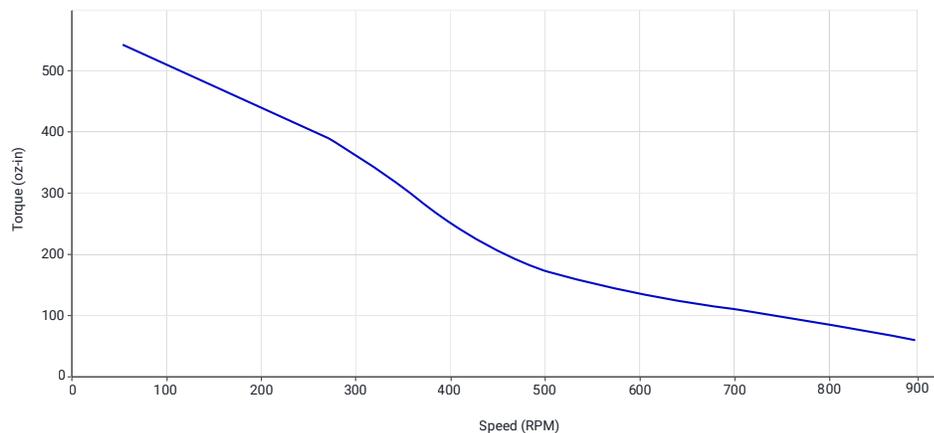


## OPERATING SPECIFICATIONS

Radial Play	0.03 mm @ 0.45 kg (0.001 in @ 1.00 lbs)
End Play	0.08 mm @ 1.36 kg (0.003 in @ 3.00 lbs)
Shaft Run Out	0.05 TIR (0.002 TIR)
Concentricity of Mounting Pilot to Shaft	0.08 TIR (0.003 TIR)
Perpendicularity of Mounting Pilot to Face	0.08 TIR (0.003 TIR)
Max Radial Load at Dimension "K" from mounting face	17.69 kg (39.00 lbs)
Dimension "K"	15.74 mm (0.62 in)
Max Axial Load	6.80 kg (15.00 lbs)
Maximum Case Temperature	80°C (176°F) Maximum
Ambient Temperature	-20°C to 50°C (-4 to 122°F)
Storage Temperature	-20°C to 100°C (-4 to 212°F)
Humidity Range (%)	85% or less, non-condensing
Magnet Wire Insulation	Class B 130 ° C
Insulation Resistance	100M Ohm at 500 VCD
Dielectric Strength	500 VCD for 1 min.


## OPERATION & USAGE TIPS

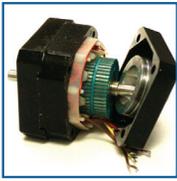


**Do not** disassemble motors; a significant reduction in motor performance will occur.

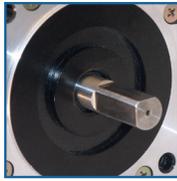

**Do not** machine shafts; this will have a negative effect on shaft run out and perpendicularity.

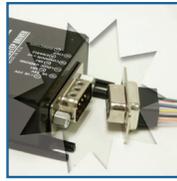

**Do not** disconnect motor from drive while in operation.

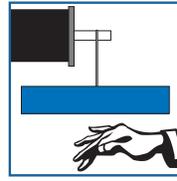

**Do not** use holding torque/detent torque of motor as a fail safe brake.



**Do not** hold motor by lead wires.



**Do not** exceed the rated current; this will burn the motor.

FAILURE TO COMPLY WITH THESE RECOMMENDATIONS WILL VOID ALL WARRANTY TERMS

## RECOMMENDED



Power Supply  
**PW-150-24**



Stepper Driver+Controller  
**R356**



Stepper Driver  
**R710**

# Motion Control, Solved.


## MOTOR ENGINEERING & MANUFACTURING



Optimized  
For Your  
Application



Quick  
Prototype  
Turnaround

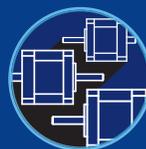

Small Batch  
to OEM Volume  
Production



US Based  
Support &  
Manufacturing